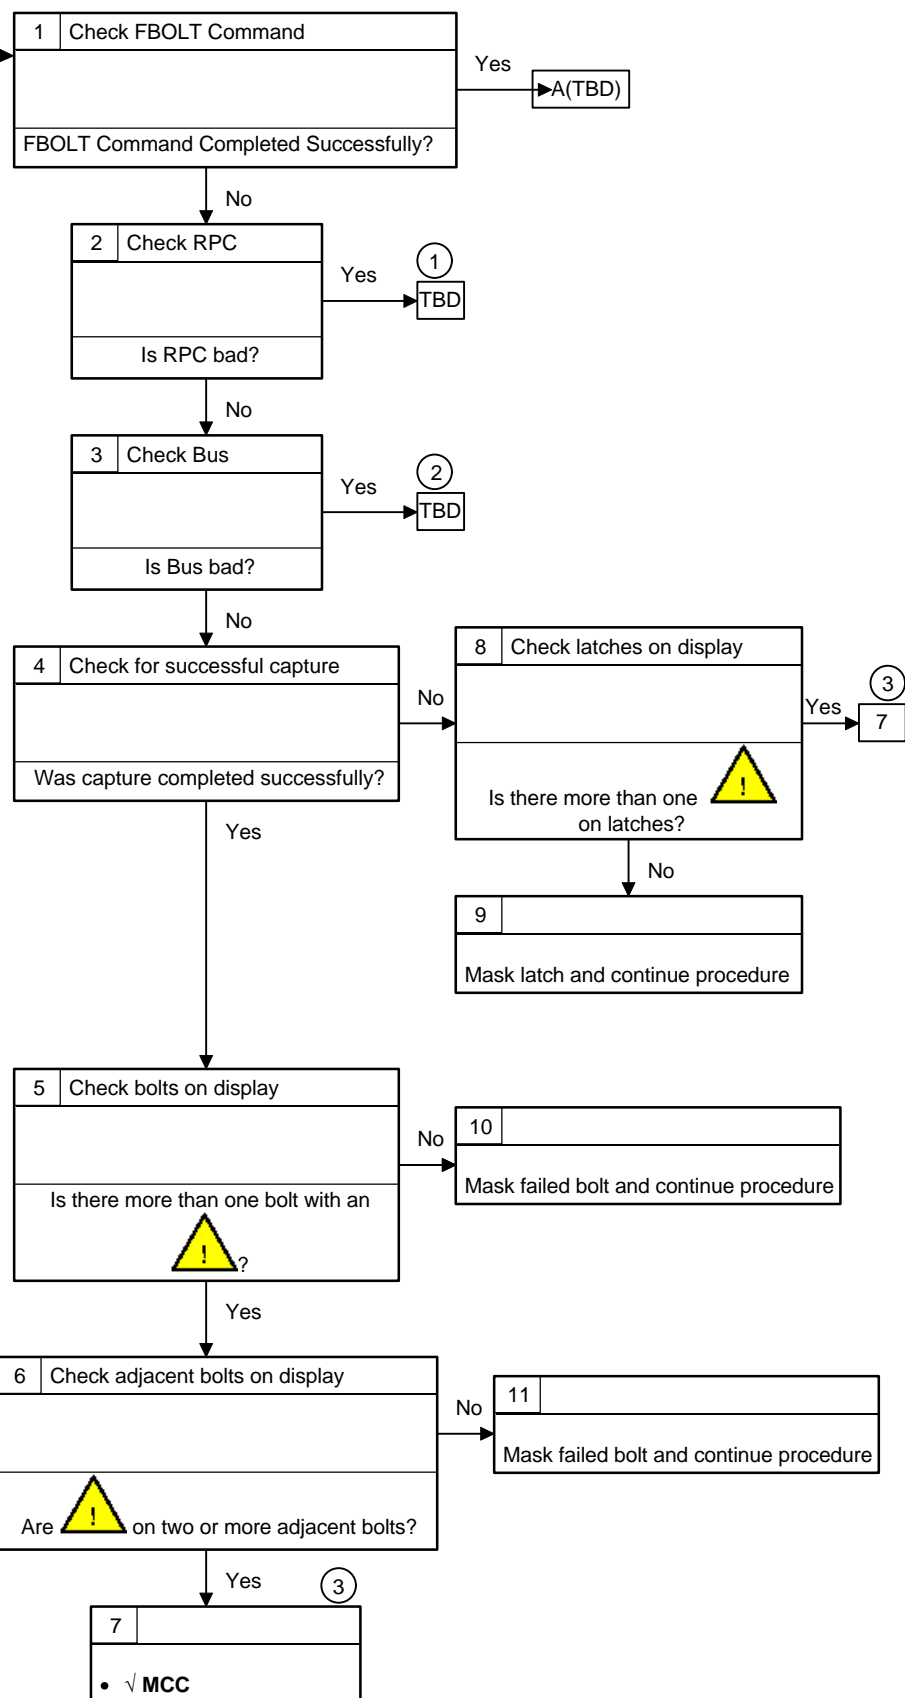


OSO

CBM MALFUNCTION

CAUTION
ALARMAttention Symbol
will appear on
displayUser Notification
Display will show
incorrect data
highlighted in redNominal Config:
Mal:Nom:Text①
EPS②
C & DH③
Check with MCC for
further instructions.
With two or more
adjacent bolts out,
CBM interface may
leak during vestibule
pressurization.